



FLORENCE COPPER INC.

1575 W. Hunt Highway, Florence, Arizona 85132 USA

florencecopper.com

August 5, 2019
File No. 132473-003

ADEQ Water Quality Compliance Section
Mail Code 5415B-1
1110 West Washington Street
Phoenix, Arizona 85007

Attention: Mr. Tracy Bunch

Subject: Weekly Monitoring Report for Week Ending 07/27/2019
Florence Copper, Production Test Facility
Aquifer Protection Permit No. 106360, LTF 61845

Dear Mr. Bunch:

Florence Copper is submitting this report in accordance with Table 4.1-8 and Section 2.7.4.4 of the Production Test Facility Temporary Aquifer Protection Permit (APP) No. 106360.

In accordance with Table 4.1-8 of the APP, this report includes In-Situ Best Available Demonstrated Control Technology (BADCT) compliance monitoring for the PTF that is required to be reported on a weekly basis including:

- Recovered volume to injection volume;
- Inward hydraulic gradient; and
- Maximum injection pressure.

A map showing the location of the PTF injection, recovery, and observation wells is included as Figure 1.

Recovered Volume to Injection Volume

A summary of the injected and recovered volumes for the week 07/21/2019 to 07/27/2019 is included in Table 1. The total injected and recovered volumes for the PTF as a daily total are also presented on Figure 2. On July 25th, recovery well R-09 was converted to injection, and injection well I-01 was converted to recovery. Daily reports were adjusted to reflect this adjustment.

During the reporting period no exceedance of the alert level was measured for recovered volume to injected volume. The alert level is the recovered volume shall exceed the injected volume.

Inward Hydraulic Gradient

Table 2 includes a summary of water levels in the recovery and observation well pairs. Hydrographs showing the water level elevation for each recovery well and observation well pair are included in Figure 3.



During the reporting period, there was no exceedance of the alert level for the inward hydraulic gradient. The alert level for the inward hydraulic gradient is that the water level elevation in the paired observation well must be a minimum of 1 foot higher than the paired recovery well.


Injection Pressure

A summary of the injection pressures during the reporting period is included as Table 3. Injection pressures are reported for R-09 starting on July 25th, when the well was converted from recovery to injection. Injection well I-01 was switched from injection to recovery at the same time.

During the reporting period no alert levels were exceeded for injection pressure, the injection pressure limit for the injection wells is limited by the fracture gradient of 0.65 pounds per square inch (psi) per foot. For the PTF injection wells this pressure limit equates to 104 psi.

Please contact me at 520-374-3984 if you require any additional information.

Sincerely,
Florence Copper Inc.

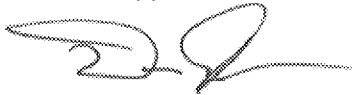

Dan Johnson
Vice President – General Manager

Attachments:

Tables and Figures

cc: Marybeth Greenslade, ADEQ
Nancy Rumrill, United States Environmental Protection Agency

TABLES

Table 1. Injected and recovered volumes (gallons) for the week 07/21/2019 – 07/27/2019

Date	Daily Injection Flow	Daily Recovery Flow	Ratio PLS/Raff	% Recovery
7/21/2019	339100	377600	1.11	111
7/22/2019	334900	373200	1.11	111
7/23/2019	307900	346400	1.13	113
7/24/2019	310900	349400	1.12	112
7/25/2019	311700	350500	1.12	112
7/26/2019	304200	345600	1.14	114
7/27/2019	328200	369500	1.13	113
Weekly Average	319557	358886	1.12	112

Table 2. Average daily water levels in the recovery and observation well pairs (amsl)

Well Pairs Avg Elev	7/21/19	7/22/19	7/23/19	7/24/19	7/25/19	7/26/19	7/27/19
R-01	1224.55	1224.14	1224.90	1224.54	1225.27	1226.61	1227.31
O-01	1235.86	1236.01	1236.03	1235.83	1235.48	1236.65	1235.79
O-07	1235.45	1235.51	1236.20	1235.77	1236.74	1239.19	1240.21
R-02	1216.66	1215.06	1207.41	1213.07	1209.24	1203.94	1215.69
O-01	1235.86	1236.01	1236.03	1235.83	1235.48	1236.65	1235.79
O-02	1236.16	1236.10	1235.28	1235.37	1235.37	1235.72	1234.09
R-03	1210.52	1207.62	1194.41	1197.01	1198.15	1191.84	1190.55
O-02	1236.16	1236.10	1235.28	1235.37	1235.37	1235.72	1234.09
O-03	1234.67	1234.08	1232.21	1232.15	1233.15	1230.56	1230.41
R-04	1207.62	1204.29	1187.86	1190.25	1190.30	1186.94	1186.94
O-03	1234.67	1234.08	1232.21	1232.15	1233.15	1230.56	1230.41
R-05	1216.08	1214.22	1206.29	1207.03	1206.29	1196.99	1198.45
O-04	1235.25	1235.08	1234.70	1234.76	1235.86	1234.42	1234.33
R-06	1214.02	1211.45	1200.68	1208.19	1209.34	1192.85	1192.18
O-04	1235.25	1235.08	1234.70	1234.76	1235.86	1234.42	1234.33
O-05	1235.98	1235.92	1235.97	1236.02	1237.06	1235.93	1235.86
R-07	1232.77	1232.82	1233.46	1233.20	1234.33	1233.36	1233.23
O-05	1235.98	1235.92	1235.97	1236.02	1237.06	1235.93	1235.86
O-06	1235.25	1235.31	1235.91	1235.77	1236.57	1236.07	1236.03
R-08	1217.11	1216.86	1218.24	1217.40	1218.90	1218.45	1219.37
O-06	1235.25	1235.31	1235.91	1235.77	1236.57	1236.07	1236.03
O-07	1235.45	1235.51	1236.20	1235.77	1236.74	1239.19	1240.21

Table 3. Injection well pressures (psi)

Date	I-01			I-02			I-03			I-04			R-09		
	AVG	MIN	MAX	AVG	MIN	MAX	AVG	MIN	MAX	AVG	MIN	MAX	AVG	MIN	MAX
7/21/2019	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00			
7/22/2019	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00			
7/23/2019	0.00	0.00	0.04	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00			
7/24/2019	0.00	0.00	0.04	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00			
7/25/2019				0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
7/26/2019				0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
7/27/2019				0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00

FIGURES

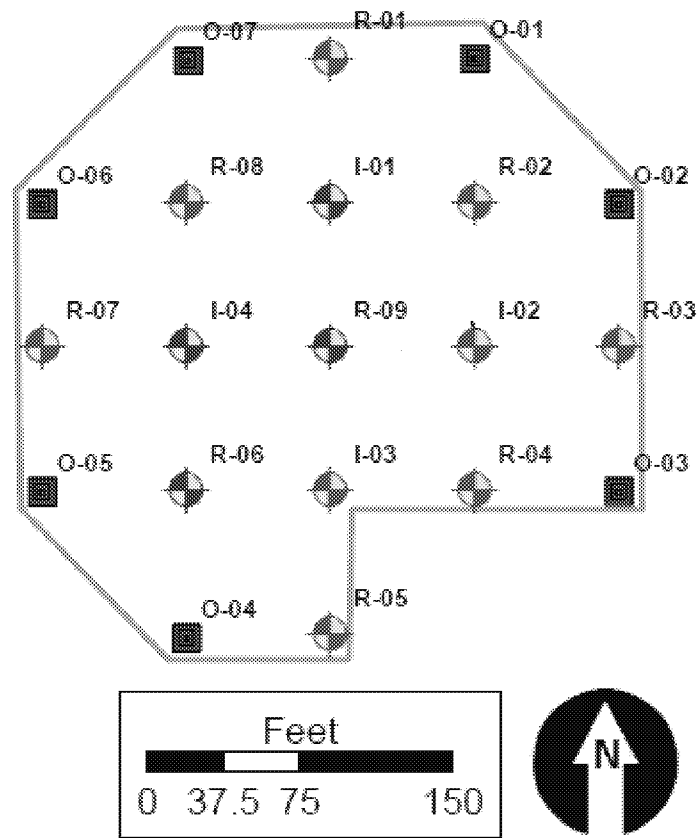


Figure 1. PTF injection, recovery, and observation well locations

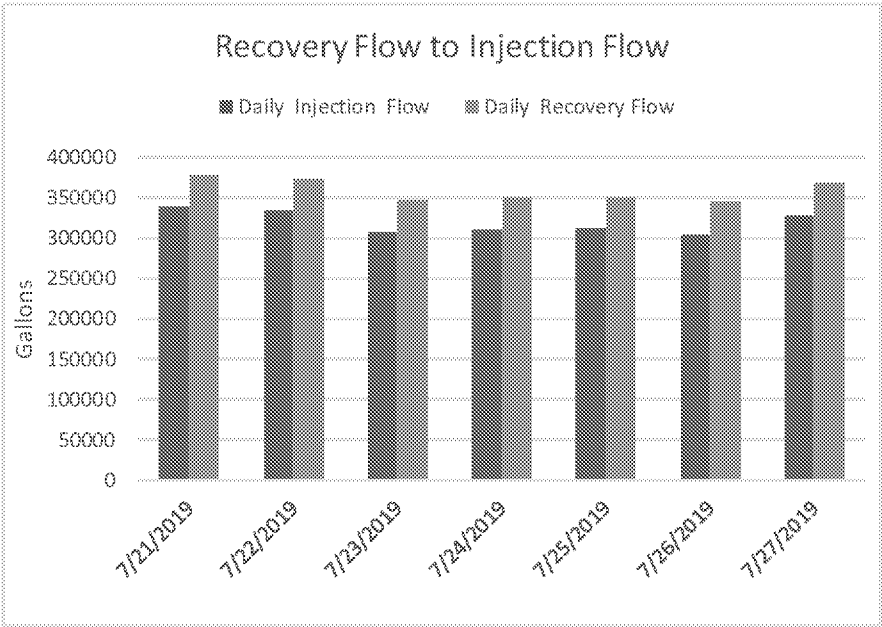


Figure 2. Recovered volume to injected volume

Figure 3

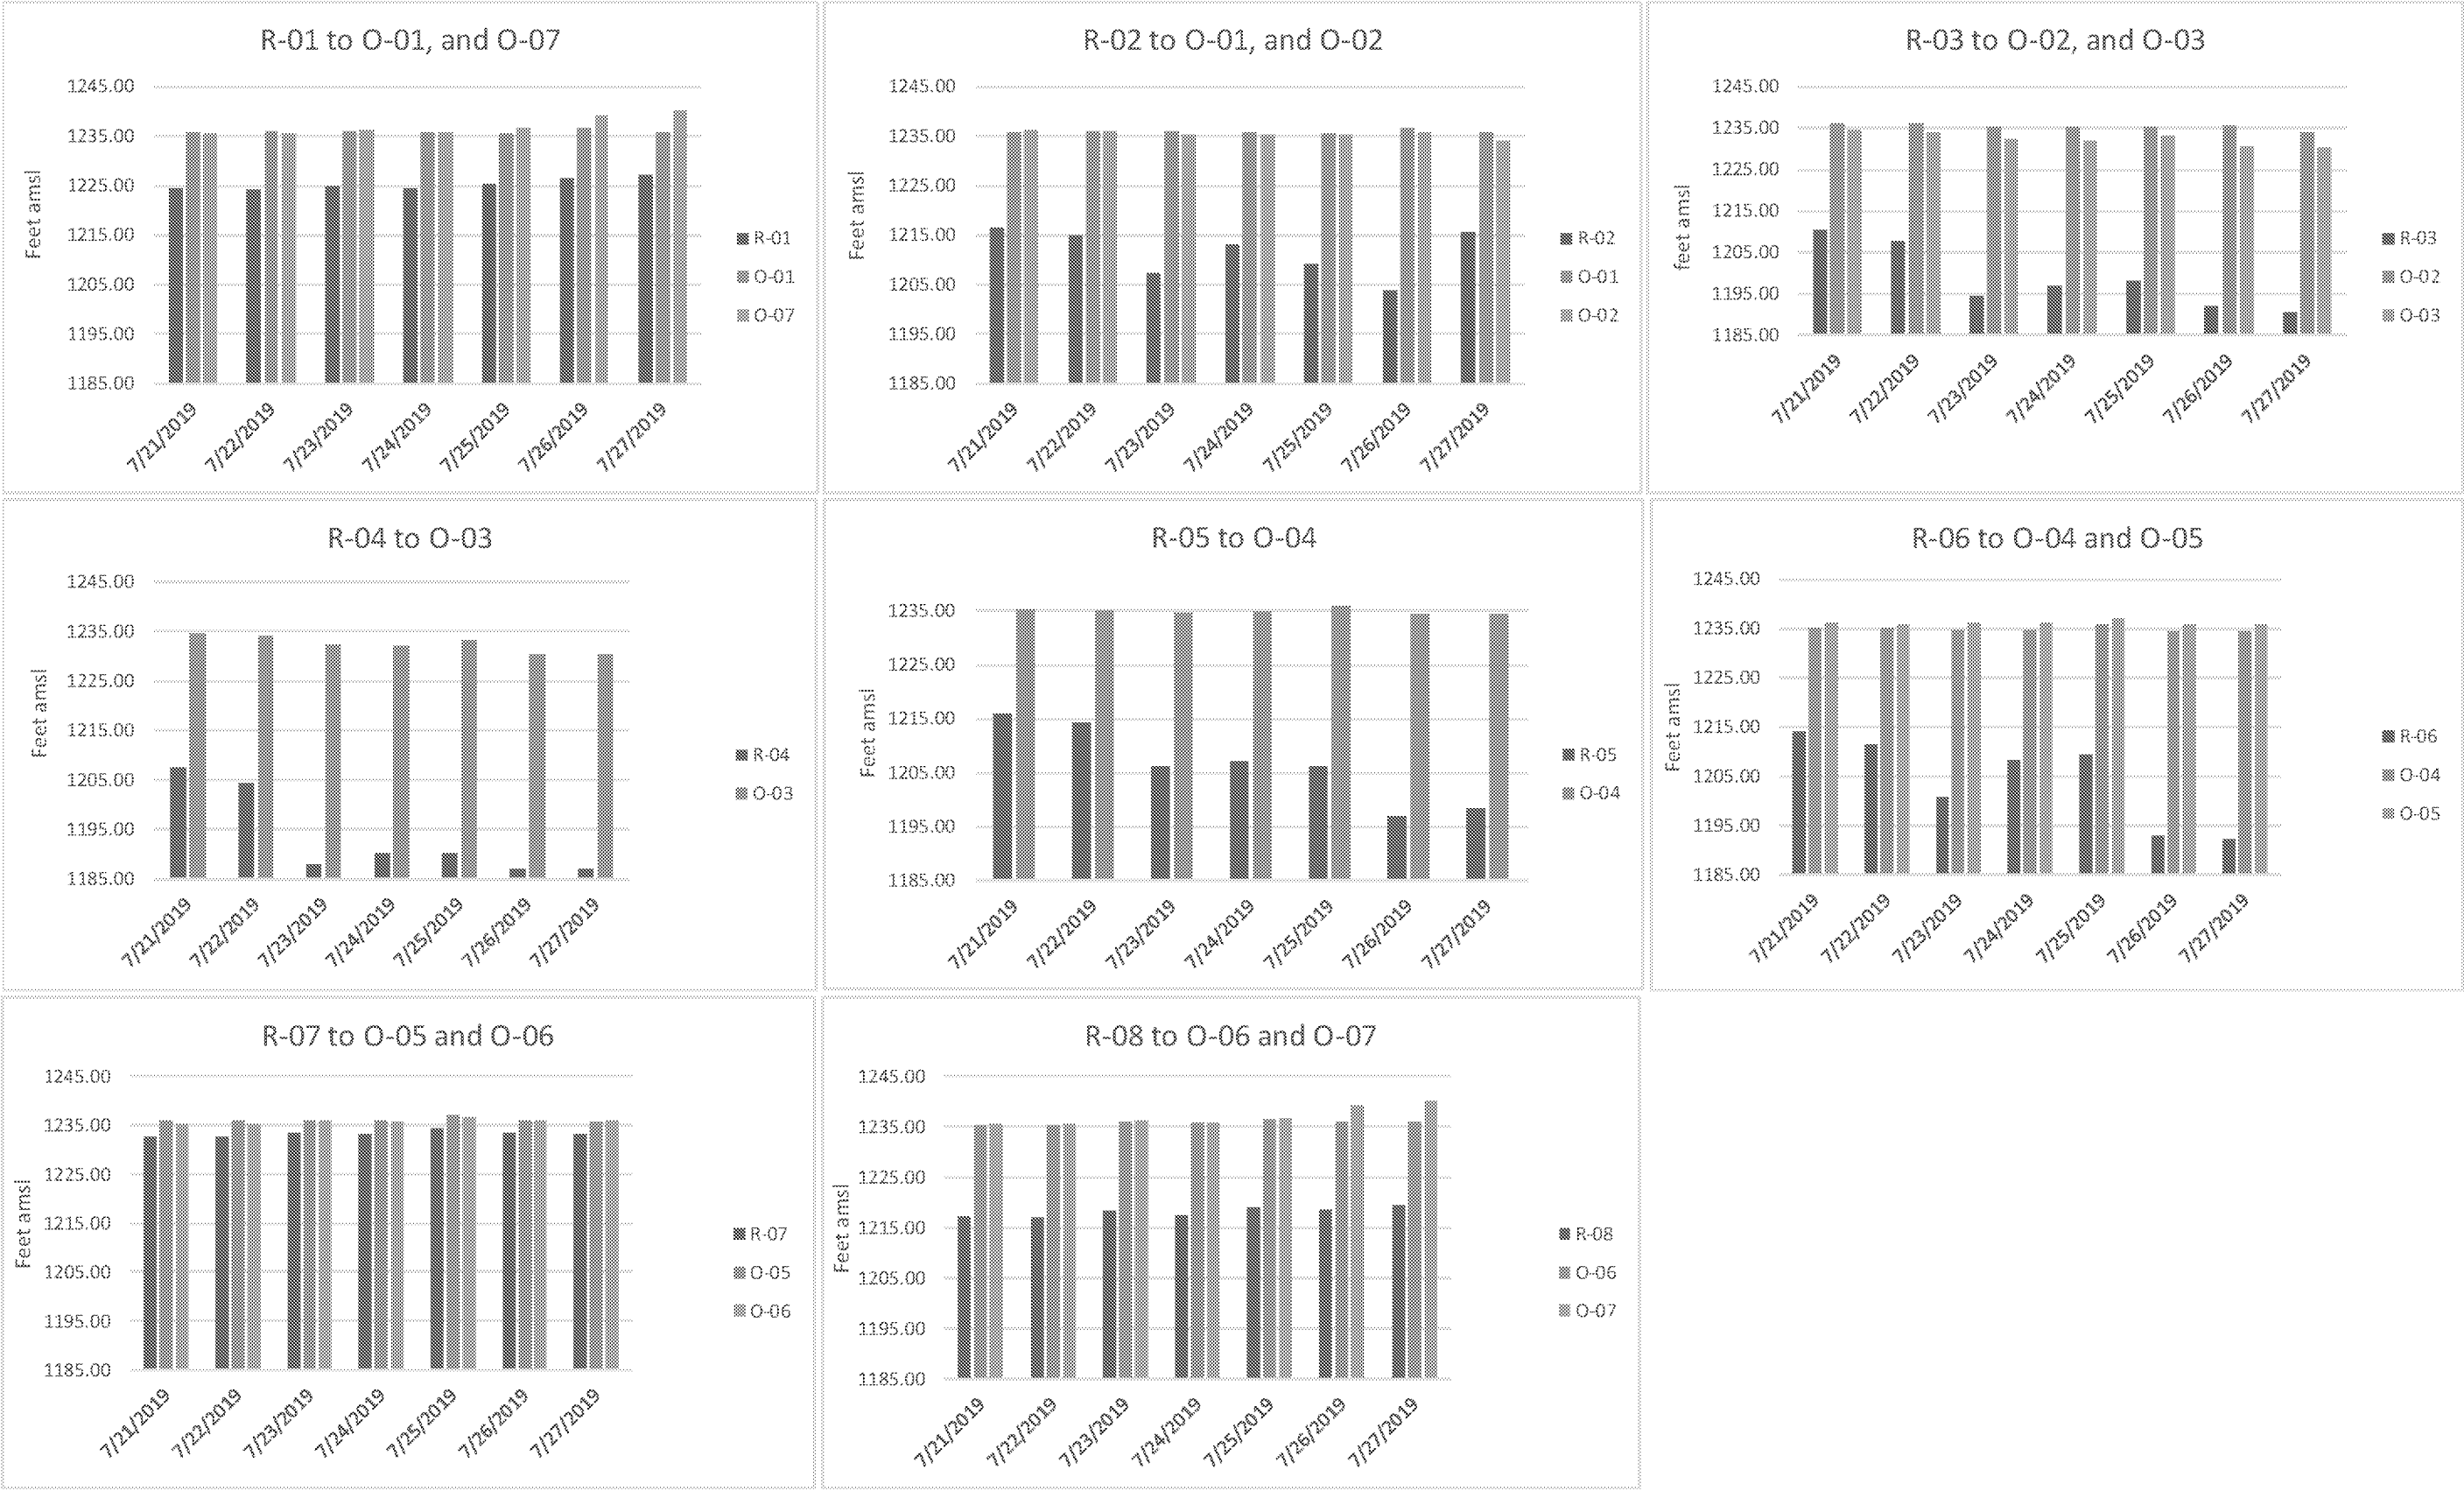


Figure 3. Recovery and observation well pairs